


Caution

Engine wear can cause increased crankshaft endplay. This can result in damage to the Crankshaft Position Sensor.

If you see score marks like this on your old sensor, you should install a spacer shim on the new sensor to prevent damage to the new sensor.

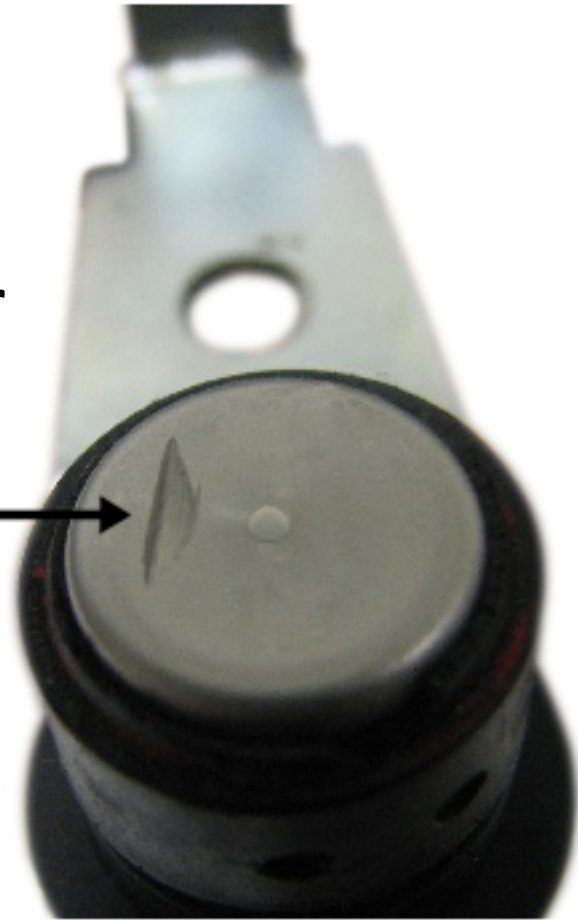

Spacer Shim Part # SU12931